



INVESTOR IN PEOPLE

The Patent Office  
Concept House  
Cardiff Road  
Newport  
South Wales  
NP10 8QQ

I, the undersigned, being an officer duly authorised in accordance with Section 74(1) and (4) of the Deregulation & Contracting Out Act 1994, to sign and issue certificates on behalf of the Comptroller-General, hereby certify that annexed hereto is a true copy of the documents as originally filed in connection with the patent application identified therein.

In accordance with the Patents (Companies Re-registration) Rules 1982, if a company named in this certificate and any accompanying documents has re-registered under the Companies Act 1980 with the same name as that with which it was registered immediately before re-registration save for the substitution as, or inclusion as, the last part of the name of the words "public limited company" or their equivalents in Welsh, references to the name of the company in this certificate and any accompanying documents shall be treated as references to the name with which it is so re-registered.

In accordance with the rules, the words "public limited company" may be replaced by p.l.c., plc, P.L.C. or PLC.

Re-registration under the Companies Act does not constitute a new legal entity but merely subjects the company to certain additional company law rules.

Signed

Dated 28 October 2003

**THIS PAGE BLANK (USPTO)**



# The Patent Office

26NOV02 E766124-6 D01038  
P01/7700 0.00-0227461.1  
**1/77**

## Request for grant of a patent

(See the notes on the back of this form. You can also get an explanatory leaflet from the Patent Office to help you fill in this form)

The Patent Office  
Cardiff Road  
Newport  
South Wales  
NP10 8QQ

1. Your reference P104455GB/SAB/48567

2. Patent application number  
(The Patent Office will fill in this part) **0227461.1**

3. Full name, address and postcode of the or of each applicant (underline all surnames) **25 NOV 2002**

Goodrich Control Systems Limited  
C/o Ernst & Young  
400 Capability Green  
Luton  
Bedfordshire  
LU1 3LU

Patents ADP number (if you know it)

8513582001

If the applicant is a corporate body, give the country/state of its incorporation

United Kingdom

4. Title of the invention A METHOD OF AND APPARATUS FOR DETECTING SENSOR LOSS IN A GENERATOR CONTROL SYSTEM

5. Name of your agent (if you have one)

"Address for service" in the United Kingdom to which all correspondence should be sent (including the postcode)

WITHERS & ROGERS  
Goldings House  
2 Hays Lane  
London  
SE1 2HW

Patents ADP number (if you know it)

1776001

6. If you are declaring priority from one or more earlier patent applications, give the country and the date of filing of the or each of these earlier applications and (if you know it) the or each application number	Country ---	Priority application number (if you know it)	Date of filing (day / month / year)
---	----------------	---	--

7. If this application is divided or otherwise derived from an earlier UK application, give the number and the filing date of the earlier application	Number of earlier application ---	Date of filing (day / month / year)
---	--------------------------------------	--

8. Is a statement of inventorship and of right to grant of a patent required in support of this request? (answer 'Yes' if:  
a) any applicant named in part 3 is not an inventor, or  
b) there is an inventor who is not named as an applicant, or  
c) any named applicant is a corporate body.  
See note (d)) **YES**

**THIS PAGE BLANK (USPTO)**

Patents Form 1/77

Enter the number of sheets for any of the following items you are filing with this form.  
Do not count copies of the same document

Continuation sheets of this form

Description 8

Claim(s) ---

Abstract ---

Drawing (s) 5 + 5

10. If you are also filing any of the following, state how many against each item.

Priority documents ---

Translations of priority documents ---

Statement of inventorship and right to grant of a patent (Patents Form 7/77) ---

Request for preliminary examination and search (Patents Form 9/77) ---

Request for substantive examination (Patents Form 10/77) ---

Any other documents ---  
(please specify)

11. I/We request the grant of a patent on the basis of this application.

Signature *Walters & Rogers* Date 22 November 2002  
WITHERS & ROGERS

12. Name and daytime telephone number of person to contact in the United Kingdom Simon A Beck 0117 925 3030

**Warning**

*After an application for a patent has been filed, the Comptroller of the Patent Office will consider whether publication or communication of the invention should be prohibited or restricted under Section 22 of the Patents Act 1977. You will be informed if it is necessary to prohibit or restrict your invention in this way. Furthermore, if you live in the United Kingdom, Section 23 of the Patents Act 1977 stops you from applying for a patent abroad without first getting written permission from the Patent Office unless an application has been filed at least six weeks beforehand in the United Kingdom for a patent for the same invention and either no direction prohibiting publication or communication has been given, or any such direction has been revoked.*

**Notes**

- a) *If you need help to fill in this form or you have any questions, please contact the Patent Office on 0645 500 505.*
- b) *Write your answers in capital letters using black ink or you may type them.*
- c) *If there is not enough space for all the relevant details on any part of this form, please continue on a separate sheet of paper and write "see continuation sheet" in the relevant part(s). Any continuation sheet should be attached to this form.*
- d) *If you have answered 'Yes' Patents Form 7/77 will need to be filed.*
- e) *Once you have filled in the form you must remember to sign and date it.*
- f) *For details of the fee and ways to pay please contact the Patent Office.*

**THIS PAGE BLANK (USPTO)**

P104455GB

A METHOD OF AND APPARATUS FOR DETECTING SENSOR LOSS IN A  
GENERATOR CONTROL SYSTEM

The present invention relates to a method of an apparatus for detecting sensor loss, and in particular voltage sensor loss, in a generator control system.

It is desirable to be able to control the output of a generator so as to maintain the voltage produced by the generator within acceptable limits. However generator output voltage may vary with generator speed and electrical load. A variable frequency electrical generator is shown in Figure 1. The generator comprises a pilot exciter 1 in the form of a permanent magnetic generator (PMG) having a permanent magnetic rotor 2 co-operating with a three phase stator winding 3. Power from the stator winding 3 is provided to a stator field winding 5 of a main exciter 6 via a generator controller 4. The main exciter 6 has a three phase rotor winding 7 arranged to supply current to a main rotor winding 9 via a half wave bridge rectifier 8. The main rotor winding 9 co-operates with a three phase main stator winding 10 which is connected to the generator output 11. The permanent magnetic rotor 2, the exciter rotor winding 7 and the main rotor winding 9 are attached to a common shaft 12 so as to rotate together. The shaft 12 is connected via suitable coupling means (for example a gear box) to a prime mover, such as a gas turbine aero engine. The generator controller 4 is connected to the output of the generator stator windings so as to monitor the output voltage produced by the generator.

It is known to reduce the current supplied to the stator field winding 5 of the exciter if the generator voltage rises above an acceptable threshold. Similarly, it is known to increase the current supplied to the stator exciter winding 5 if the output voltage of the generator falls below an acceptable voltage. Measurements of generator output voltage may be performed on a time averaged basis and also on a peak basis. Whilst this control system works well, there is a risk that complete failure of or poor or broken connection to the generator output voltage sensing system within the controller 4 could result in the generator voltage becoming unregulated and raising to a level where equipment supplied by the generator may become damaged.

According to a first aspect of the present invention there is provided a method of detecting sensor failure of a generator control system having at least one voltage sensor for measuring a generator output voltage and at least one current sensor for measuring a generator output current, wherein sensor failure is indicated if, during operation of the generator, the measured generator output voltage is less than a first voltage threshold and the measured generator output current is less than a current threshold.

It is thus possible to provide a method of detecting failure of the generator measurement systems, and in particular the voltage detection arrangement, within a generator control system.

Preferably a plurality of voltage sensors are provided. Thus, in the context of a three phase generator a voltage sensor may be provided to measure the voltage of each generator phase. The highest voltage occurring on any of the phases may then be used as a measurement of the generator output voltage. Thus this arrangement provides for sensor redundancy since the failure of any two of the three sensors can be tolerated. It might initially be supposed that detection of sensor failure could merely be performed by looking for a sudden reduction of measured output voltage. However such a system would have difficulty in rapidly discriminating between voltage sensor failure and output voltage collapse due to the occurrence of a large load or of a short circuit. It is important to be able to discriminate between a short circuit at the output of the generator and voltage sensor loss because they are treated differently by the generator control unit. If a short circuit load occurs then the generator should be isolated from the load but the load should not be distributed to other generators. However a voltage sensor loss would require immediate shut down of the generator but the load supplied by the generator can be transferred to other generators.

The present invention discriminates between voltage sensor failure and transitory high load conditions resulting in reduction of the generator output voltage or short circuit conditions by monitoring the generator output current. If the generator output voltage is below or equal to the first voltage threshold and the current is larger than the current threshold then a generator overload is indicated. However, if the voltage output of the generator is



measured to be below or equal to the first voltage threshold and the current output is less than or equal to the current threshold then a sensor fault is indicated.

In the case of an overload being detected, other protection circuitry would be operated to protect the generator depending on the nature of the overload and/or to shed load from the generator, with some of the loads possibly being transferred to other power supplies depending on the topology of the circuit being supplied by the generator.

Advantageously the method of detecting sensor failure is temporarily modified during generator start up. It should be appreciated that during generator start up the output voltage and output current from the generator are low thereby giving rise to the possibility that the method according to the present invention would erroneously indicate generator sensor failure as having occurred even when the sensors are functioning correctly. Preferably the output voltage of the generator is sampled or measured after a first time period following initiation of generator voltage regulation. If, at the first time period, the output voltage of the generator has risen to greater than a second voltage threshold then the voltage sensors are assumed to be functioning correctly. Preferably a second period of time is then allowed to elapse before the sensor detection method according to the first aspect of the present invention is initiated. However, if the sensor voltage fails to meet the second voltage threshold after the first period of time then it is assumed that the voltage sensors have failed and a generator shut down procedure is initiated.

According to a second aspect of the present invention there is provided a generator control system having at least one voltage sensor for measuring a generator output voltage and at least one current sensor for measuring a generator output current, wherein the generator control system is arranged to shut down a controlled generator if the measured generator output voltage is less than a first voltage threshold and the measured generator output current is less than a current threshold.

It is thus possible to provide a generator controller which can distinguish the difference between a reduction of measured generator output voltage due to a large or short circuit load occurring at the output of the generator and a reduction of measured generator output

voltage resulting from voltage sensor failure. Voltage sensor failure may result from failure of connections to the voltage sensors as well as failure of the sensors themselves or components responsive to the voltage sensors.

It will be appreciated that the voltage measuring system provided for the generator is in fact very robust and highly unlikely to fail. However, there is always a possibility that human error may result in the voltage measuring system failing to be connected to the generator control unit following maintenance or servicing of the generator. Thus the generator controller according to the present invention provides protection against excessive generator voltages which may occur as a result of the inadvertent failure to reconnect the generator sensing system. Similarly, if the current sensors are not properly connected then a low reading of the generator measured output voltage would also initiate generator shut down.

The present invention will further be described by way of example, with reference to the accompanying drawings, in which:

Figure 1 schematically illustrates a three stage generator;

Figure 2 illustrates a generator control circuit in greater detail;

Figure 3 is a flow chart illustrating the decision process according to the present invention;

Figure 4 is a flow chart illustrating the operation of the present invention during a start up phase and

Figure 5 is a circuit diagram for a hardware based arrangement for detecting sensor failure and for initiating generator shutdown.

Figure 2 shows the control unit 4 of Figure 1 in more detail. The main exciter winding 5 has a first end thereof connected via a field effect transistor 21 to the output of a rectifier 22 which receives and rectifies the output of the permanent magnet generator stator windings

3. A second end of the main exciter stator winding 5 is connected to ground via a second field effect transistor 20. The main exciter stator winding 5 is also connected in parallel with a series circuit comprising a diode 23 and a parallel circuit comprising a resistor 24 and a field effect transistor 25.

The gate of the field effect transistor 20 is connected to the output of a differential amplifier 26 having a first input connected to receive a first reference voltage VR1 and a second input connected to a rectifying averaging and conditioning circuit 27 which itself is connected to the generator output 11. The gate of transistor 25 is connected to the output of a drive circuit 28 whose input is connected to the output of a comparator 29 which has a first input connected to the output of a peak rectifier 30. An input of the peak rectifier 30 is connected to the generator output 11. The comparator 29 has a second input connected to a second reference voltage VR2.

The gate of transistor 21 is connected to the output of a drive circuit 31 which in turn is connected to the output of a latch 32. The input of the latch is connected to the output of an AND gate 33 having a first input connected to the output of the comparator 29 and a second input connected to the output of a further comparator 34. The comparator 34 has a first input connected to receive a third reference voltage VR3 and the second input connected to a node formed between the winding 5 and the field effect transistor 20.

During operation of the generator the transistors 21 and 25 are switched on so that the output of the rectifier 22 is supplied to the winding 5 and the resistor 24 is short circuited. The differential amplifier 26 compares the output voltage of the generator with a reference voltage VR1 representing the target output voltage and controls the transistor 20 so as to regulate the main exciter field by varying the current through the exciter stator winding 5. The current supplied by the rotor winding 7 via the rectifier 8 to the rotor winding 9 is thus controlled so as to vary the output of the main stator winding 10 in order to regulate the generator output voltage at the generator output 11.

The peak rectifier 30 monitors the instantaneous peak output voltage of the generator output 11. When this voltage exceeds a predetermined level represented by a voltage

reference VR2, the comparator 29 switches the transistor 25 off via the drive circuit 28 so that the resistor 24 becomes connected in series with the current recirculating path of the winding 5. The differential amplifier 26 will have also been arranged to have switched off the transistor 20 so as to remove drive to the winding 5. The recirculating current within the winding 5 is thus dissipated in the resistor 24 relatively rapidly so as to prevent the instantaneous peak output voltage of the generator from exceeding a permissible value.

The comparator 34 compares the voltage at one end of the field winding with the reference voltage VR3 in order to detect the occurrence of a short circuit from the end of the field winding 5 to ground. When such a short circuit is detected and when the comparator 29 signals that a large instantaneous peak output voltage has occurred, the AND gate 33 triggers the latch 32 thereby removing drive from the transistor 21. Drive to the exciter winding 5 is thus removed and cannot be restored until the latch 32 is reset.

Whilst control circuits of this type work well, they have no inherent protection against failure of the voltage sensors to circuits 27 and 30. This can however be rectified by incorporating a further logic block 50 which is responsive to the output of the peak rectifier 30 and also to a current measuring device 52. An output of the further logic block 50 can be supplied to the latch 32 giving the logic block 50 the authority to operate the latch 32 so as to inhibit current flow through the transistor 21.

Figure 3 shows the decision process performed by the logic block 50. Control commences at step 60. From here, control is passed to step 62 where the output  $V_{\text{peak}}$  of the peak rectifier 30 is compared with a first voltage threshold  $TH_{v1}$ . If the voltage is less than  $TH_{v1}$  then control is passed to step 64 otherwise control loops round to the beginning of step 62 again. At step 64 the generator output current  $I_{\text{out}}$  is compared with a first current threshold  $TH_{i1}$ . If the output current is less than  $TH_{i1}$  then control passes to step 66 which is indicative of a sensor failure and generator shut down is initiated by sending a signal to the latch 32. However, if the generator output current is greater than the first current threshold  $TH_{i1}$  then control passes to step 68 which indicates a possible overload condition where generator protection measures may be invoked. From step 68 control is passed back to the beginning of step 62. It will be appreciated that the implementation of the flow diagram of

Figure 3 can be achieved equally easily in both hardware and software. A hardware implementation is preferred as this is likely to be more reliable. The voltage and current threshold chosen will vary with nominal output voltage and generator size. However for a 115V system having a 150 KVA generator a voltage threshold of 50 Volts and a current threshold of 600 Amperes seem appropriate.

Figure 4 illustrates a modification to the generator protection scheme which is initiated during the start up phase. Control commences at step 70 from where control is passed to step 72 where the sensor failure protection (i.e. generator shutdown if the voltage sensors are deemed to have failed) is temporarily inhibited. From step 72 control is passed to step 74 where a test is repeatedly made to see whether generator voltage regulation has been enabled, which corresponds to instructing the generator to supply power. Once the generator voltage regulation is enabled control is passed to step 76 where a period T1 is timed. The period T1 is typically in range of 15 to 20 milliseconds. Control is then passed to step 78 where the voltage  $V_{peak}$  is compared with a second voltage threshold  $TH_{V2}$ . The second voltage threshold  $TH_{V2}$  typically has a value of 20 volts or so. If  $V_{peak}$  is greater than  $TH_{V2}$  then it is assumed that the voltage sensors are operating correctly and control is then passed to step 80 where a further period T2 of around 80 milliseconds is timed out before control is passed to step 82 where the sensor failure protection is re-enabled. Thus it will be seen that sensor failure protection is inhibited for a period of approximately 100 milliseconds following initiation of the instruction to the generator to start providing a regulated output. However, if step 78 determines that the measured generator peak output voltage  $V_{peak}$  is less than  $TH_{V2}$  then it is immediately assumed that the voltage sensors are not operating and control is passed to step 82 where the voltage sensor protection is enabled. This will, of course, immediately seek to determine whether the generator output is short circuited or whether voltage sensor failure has indeed occurred and will take appropriate action.

Figure 5 schematically illustrates the circuit diagram for the logic circuit 50. The logic circuit comprises a comparator 90 having an inverting input connected to the output of the peak rectifier 30 and a non-inverting input connected to receive voltage threshold  $TH_{V1}$ . An output of the comparator 90 is supplied to a first input of an AND gate 94. A second

comparator 92 has an inverting input connected to the generator output current measuring element 52 and a non-inverting input connected to receive the first current threshold  $TH_{I1}$ . An output of the comparator 92 is connected to a second input of the AND gate 94. An output of the AND gate 94 is connected to a first input of an electronically operated switch 96. The switch 96 is controlled such that following generator start up it supplies the output of the AND gate 94 to the latch 32. However, during a generator start up phase the switch 96 is controlled so as to disconnect the output of the AND gate 94 from the latch 32. The switch 96 is controlled by a timer 98 which has a first input responsive to a generator enable signal used to switch the generator on and the second input responsive to an output of a further comparator 100 which has a non-inverting input connected to receive the rectifier output voltage  $V_{peak}$  and its inverting input connected to receive a second voltage reference  $TH_{V2}$ . Thus the comparator 100 performs the comparison of step 78.

It is thus possible to provide a generator controller which can detect failure of its voltage sensing elements and initiate a generator shut down in order to ensure that devices connected to the generator cannot be damaged by generator over voltage.




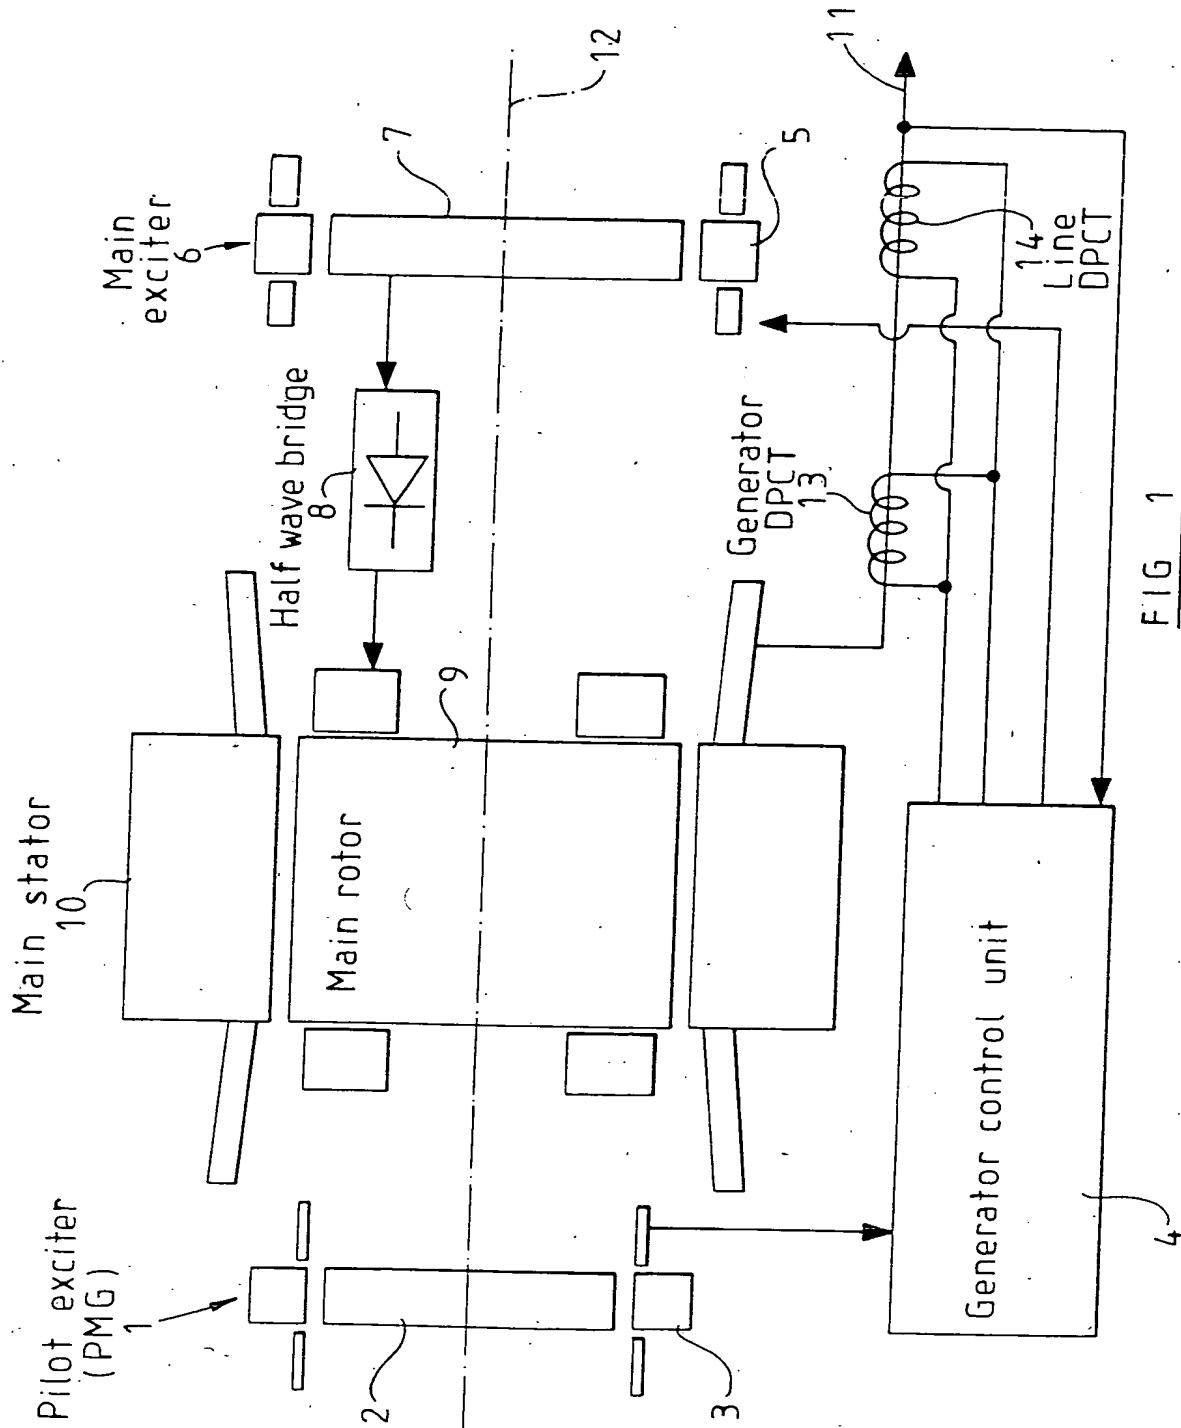


FIG. 1


THIS PAGE BLANK (USPTO)



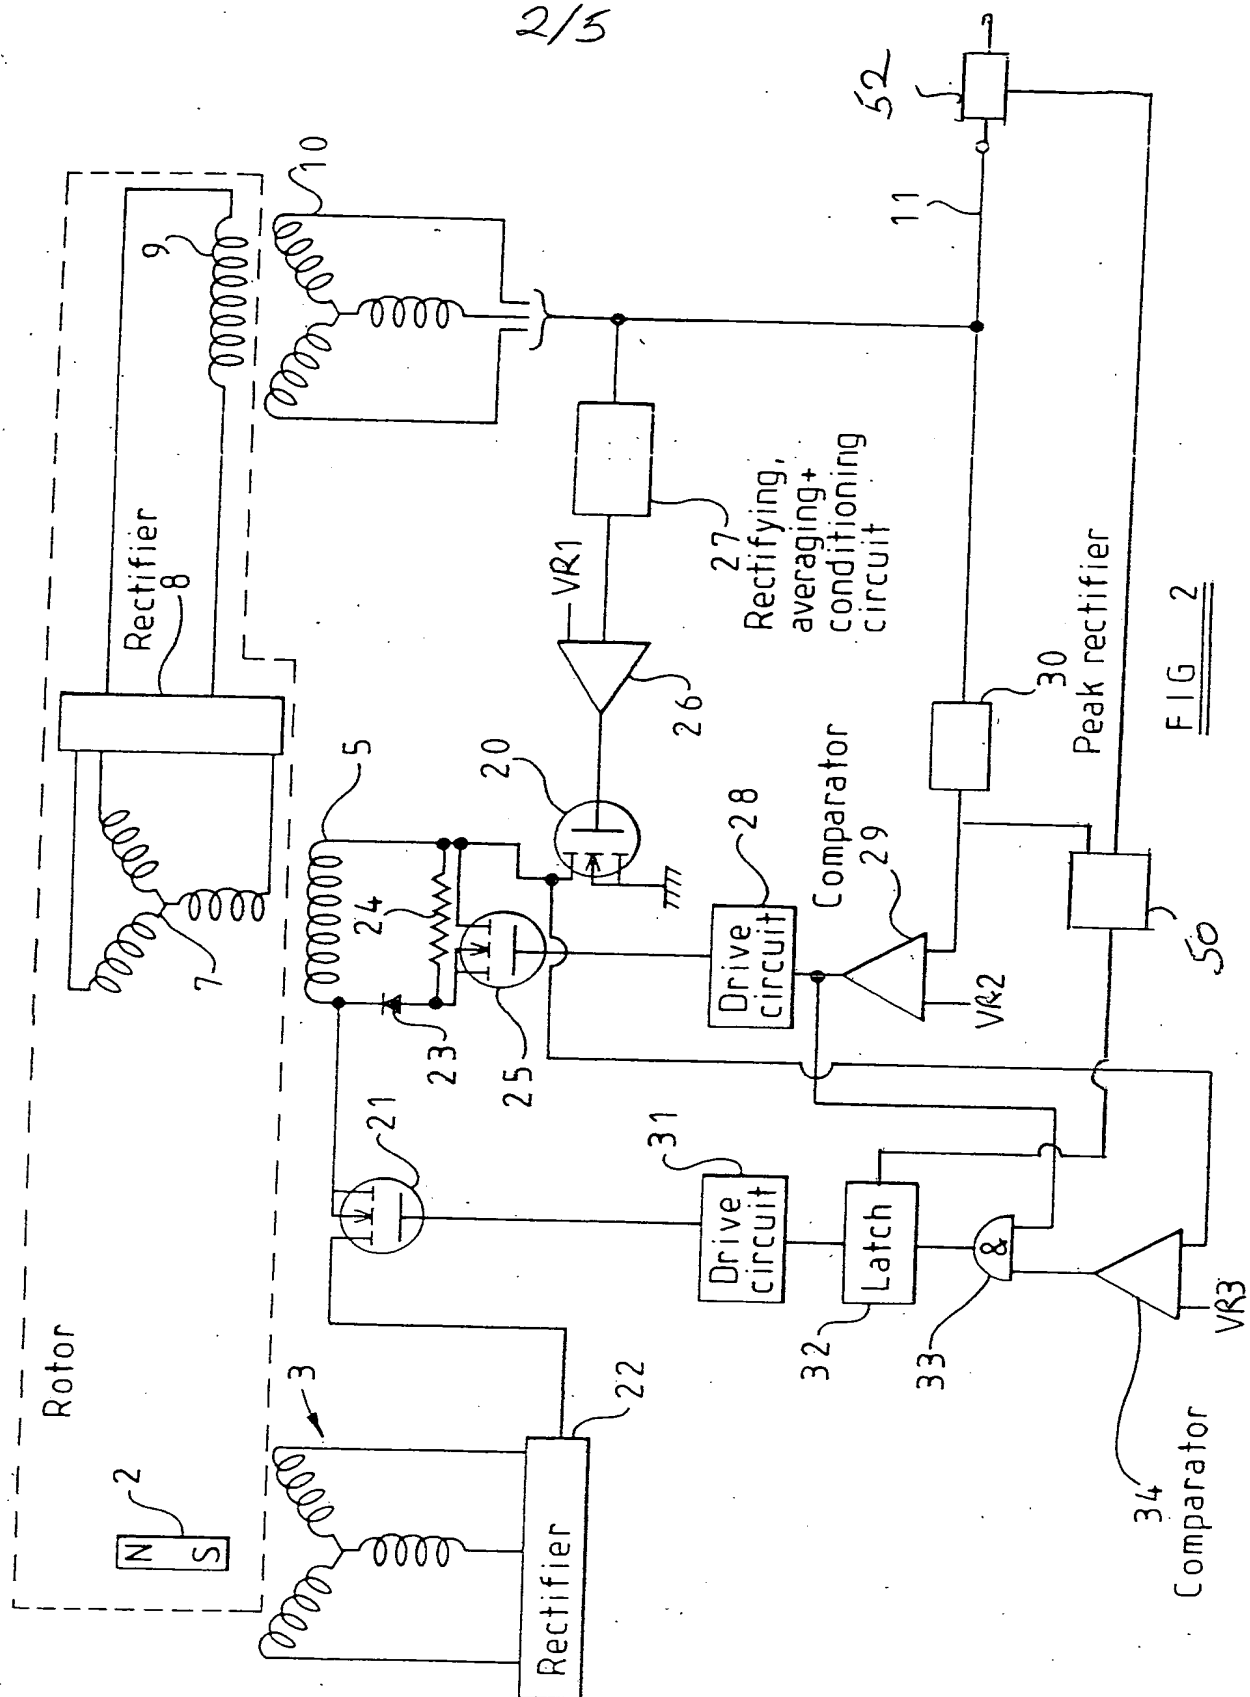

**THIS PAGE BLANK (USPTO)**


Fig 3

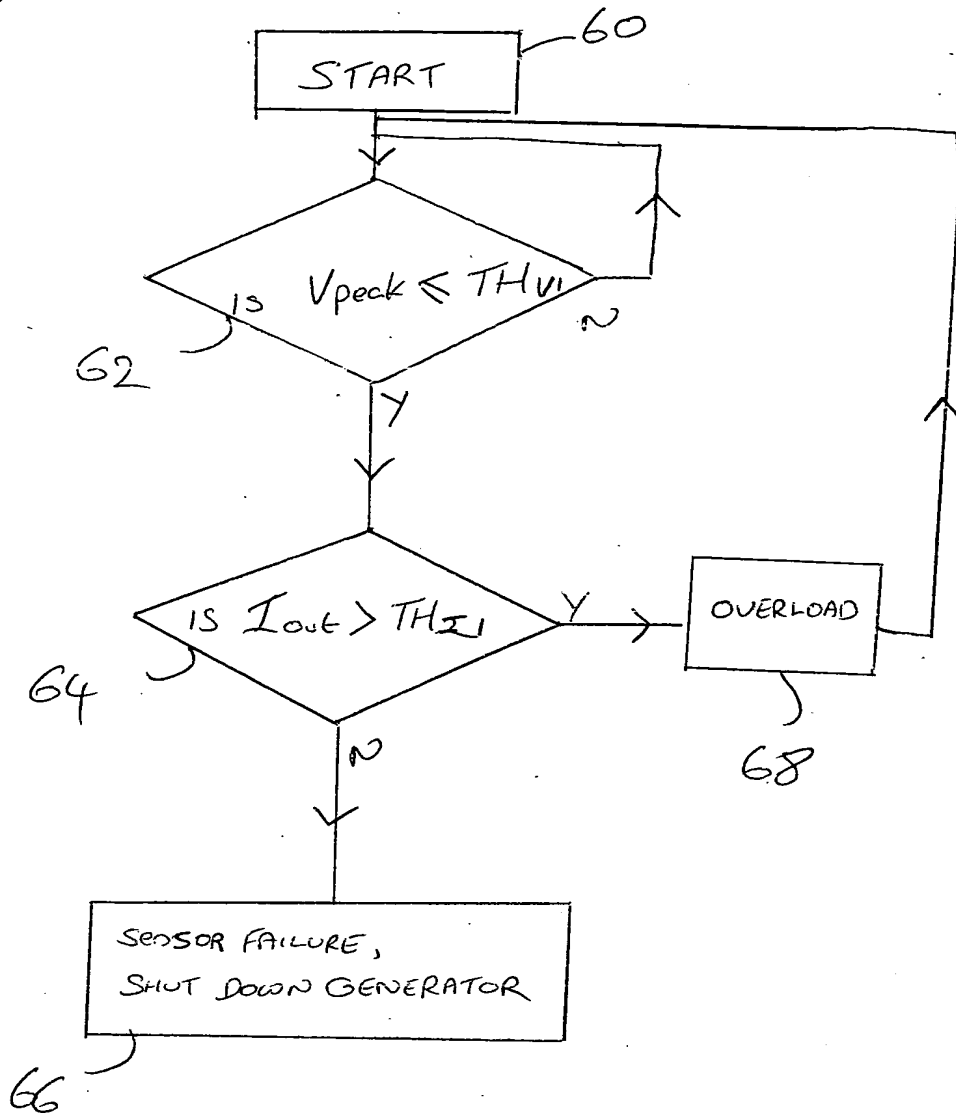

THIS PAGE BLANK (USPTO)

Fig 4

4/5

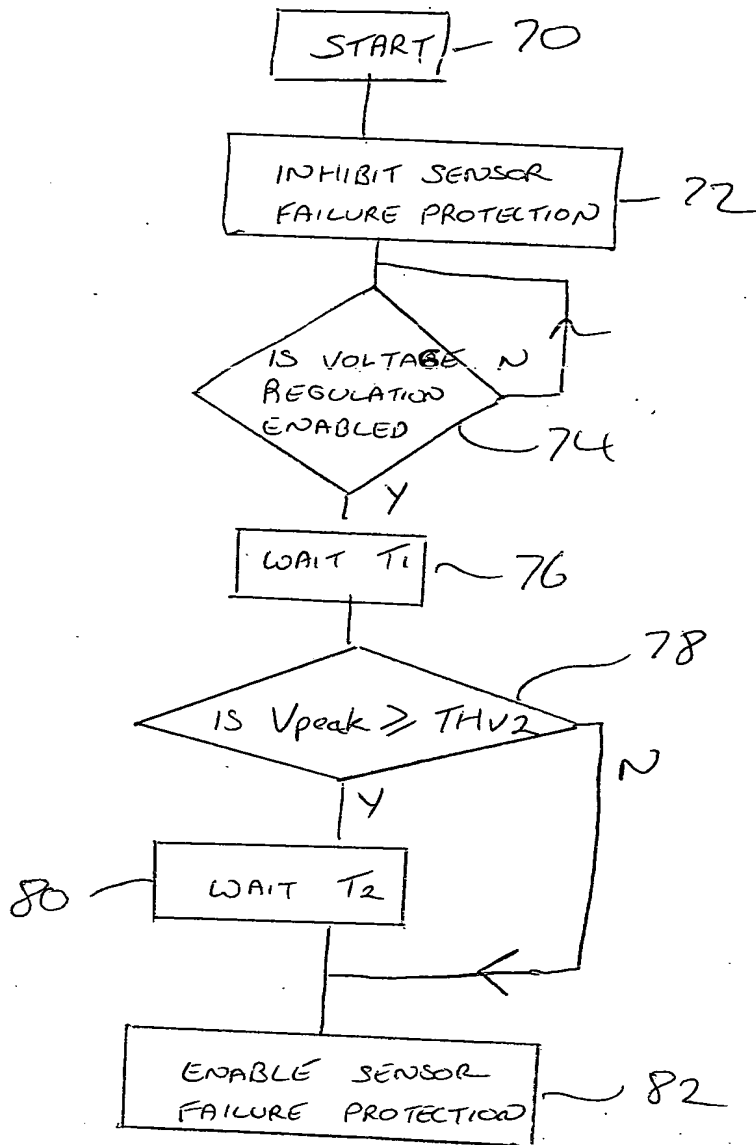




**THIS PAGE BLANK (USPTO)**

Fig 5

5/5

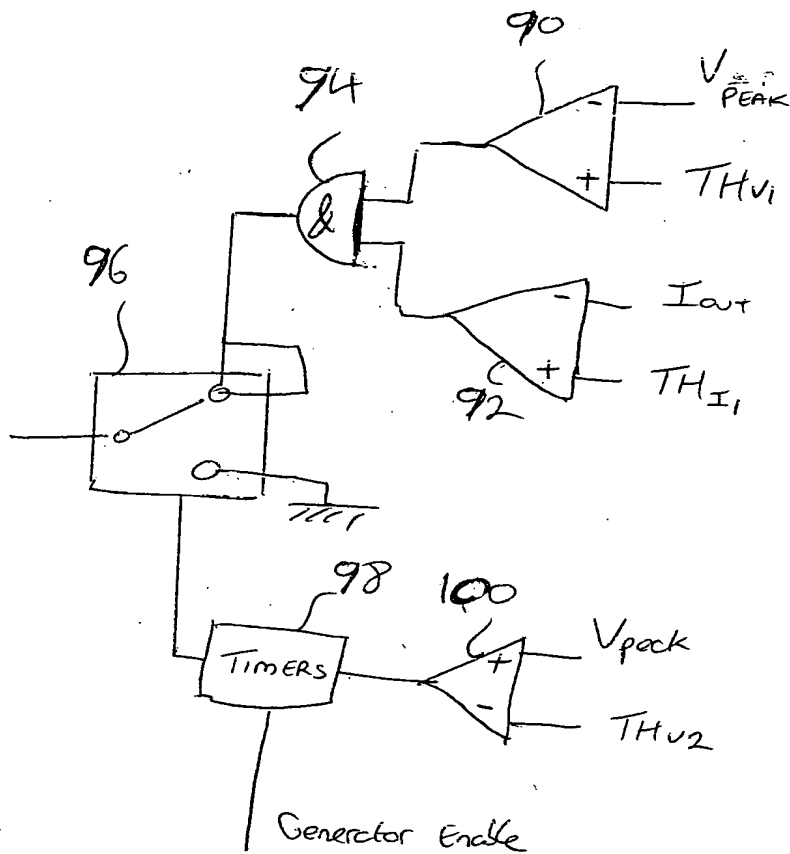

THIS PAGE BLANK (USPTO)